




EasyView w/LinkBoard Installation

1. Inspect your new easy view kit to ensure it is complete. Your new kit should consist of the following parts:
 - a. one metal easy view adapter w/LinkBoard installed.
 - b. two small black sheet metal screws
 - c. one lock washer

You will need a #2 Phillips screwdriver for this installation

2. Unplug your kiln from the wall. If your kiln is direct wired, turn the breaker or disconnect switch to the off position.
3. Remove the four black sheet metal screws that hold the touchpad to the control box. When removing the last screw, be sure to hold the touchpad in place. Save these screws.
4. Hold your EasyView adapter in your free hand while gently removing the touchpad from the control box. Thread the touchpad through the hole in the back of the easy view adapter, taking care not to pull on the attached wiring.
5. Place the red wire with the piggyback connector (Part #: 2679) onto the center tap of the touchpad. Connect the wire that was previously on the center tap to the additional connector of the piggyback.
6. Connect the second red wire to Output 4 on the touchpad.
7. Connect the ribbon cable onto its outlet on the touchpad. Be sure to line it up correctly, as one side of the ribbon cable connector has a notch in it that aligns with the outlet on the touchpad.
8. Place the EasyView adapter in place on the control box by locating the metal flange over the bottom opening in the control box.
9. Align the touch pad in the easy view adapter and loosely install two of the black sheet metal screws in the bottom two holes of the touchpad. Line up the top two holes of the touchpad with the upper two holes of the control box and loosely install the top two sheet metal screws. We have supplied two extra screws in case some are lost.

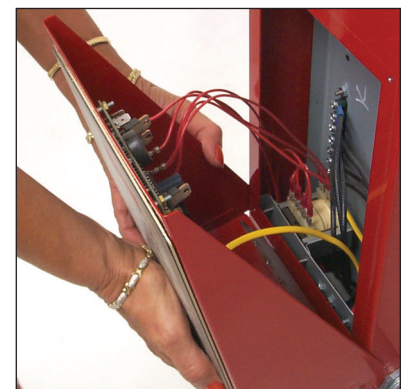

EASYVIEW W/LINKBOARD INSTALLATION

7. With the touchpad and easy view adapter held loosely in position, remove the lower right hand sheet metal screw and insert the lock washer behind the touchpad. Reinstall the sheet metal screw and gently tighten all the screws in place.

8. When the installation is complete, your easy view should be securely fastened to the control box. The top of the easy view is held in position with the sheet metal screws. The bottom is held in place with the interlocking metal flange.

Turn the power to the kiln on and check the touchpad for normal operation.

The EasyView with Linkboard ships with the LinkBoard already mounted and the two red wires and ribbon cable connected to the Linkboard. If you ordered the EZ view with a 775 board, that will be installed as well.